




## Taiacryl Dark Blue 2RN-T

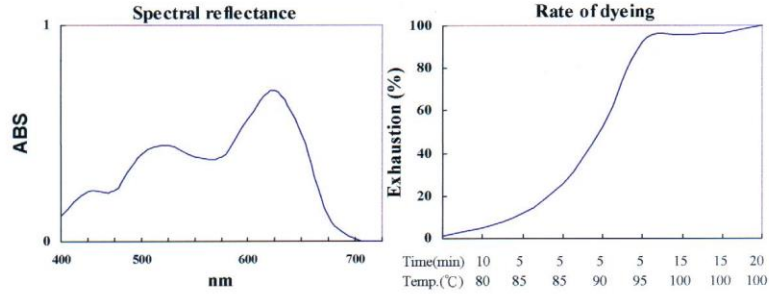

### Dyes Properties 染料特性

F value F 值	K value K 值	Solubility 85 °C 溶解度	Liquor ratio 浴 比	pH Stability pH 安定性	Exhaustion 浸染適性
0.75	3.0	150 g/l	◎	3-5.5	◎

Effect of Metal Ion 金屬離子影響				Rate of Dyeing 染色速率	Build up 上色性
Fe <sup>++</sup>	Cu <sup>++</sup>	Mg <sup>++</sup>	Ca <sup>++</sup>	◎	◎
△	◎	◎	◎		

Staining on 纖維污染				Continuous 連染適性	Printing 印花適性
Wool	Nylon	Cotton	PES	◎	◎
4Y	5	4R	5		

### Exhaustion Dyeing 浸 染



0.1 % o.w.f.



0.5 % o.w.f.



1.5 % o.w.f.



## Taiacryl Dark Blue 2RN-T

### Washing Properties 水洗特性 (1.5 % o.w.f.)

49°C (AATCC 61 2A) 49°C 耐水洗						Hot Water 耐熱水	
Acetate	Cotton	Nylon	Polyester	Acrylic	Wool	Alter 色變	Acrylic污染
5	5	5	5	5	5	4D	5

60°C (M&S C4A) 60°C 耐水洗						Chlorine 耐氯水	
Acetate	Cotton	Nylon	Polyester	Acrylic	Wool	Alter 色變	Acrylic污染
5	5	4-5	5	5	4-5	5	5

### Color Fastness 堅牢度 (1.5 % o.w.f.)

Dyebath Stability at High Temperature after Blank Dyeing			Dry Heat Setting	Perspiration 耐汗 Acid 酸	
100°C x 30'	110°C x 30'	120°C x 30'	180°C x 30"	Acrylic	Cotton
◎	◎	○	4-5	5	5

Light 耐光		Rubbing 耐摩擦		Perspiration 耐汗 Alkaline 鹼	
0.1 % o.w.f.	1.5 % o.w.f.	Dry 乾	Wet 濕	Acrylic	Cotton
4	5	5	5	5	5

### Printing Properties 印花特性

Reduction agent 還原劑 Dischargeability 拔染性		Dependence on Steaming 蒸處依存性		Dependence on Steaming Process 適用蒸處方式	
White 拔白	Color 入色	Temperature	Time	HPS	HTS
X	◎	◎~○	◎	◎	◎~○